



*Mr. Anderson*



Old Condition

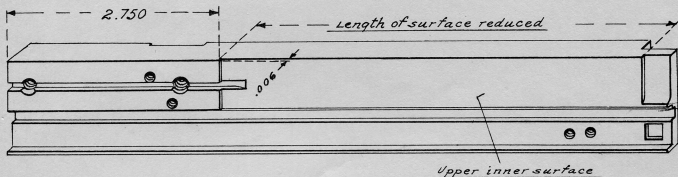

New Condition

FIRST ELEVATOR JAW (BACK)

The upper inner surface of the First Elevator Jaw (Back) has been reduced .006 of an inch to provide the same clearance on the back jaw as exists on the front jaw. This will reduce the possibility of the inner surface becoming scored.

APPLIED IN FACTORY TO MODELS

All new Models of 28-29-30-31-32-33 Series.

OUTSTANDING MODELS

Can be applied to outstanding 30 and 42 em Models by removing the back jaw and machine .006 from the upper inner surface as pointers in above view indicate.

First applied to Model 8BB, Serial #53540.

MERGENTHALER LINOTYPE COMPANY, Brooklyn, N.Y.

July 17, 1939.